



Deutscher Fallschirmsportverband (DFV) e.V.
Deutscher Aero-Club (DAeC) e.V. Luftsportgerätebüro
Verband unabhängiger Prüfer von Luftsportgerät e.V.

An alle Vereine/Schulen/
Fallschirmtechniker
Fallschirmwarte

SICHERHEITSMITTEILUNG für Gurtzeuge

herausgegeben: 22.03.2011

Nummer: 03/2011

Bezug: **Sicherheitsmitteilung der Firma Sun Path
SERVICE BULLETIN SBSP 006 vom 22. März 2011**

Betroffene Muster: Gurtzeuge der Firma Sun Path, die mit einem AAD TypArgus
der Firma Aviacom ausgestattet sind.
Das betrifft die Gurtzeuge: Javelin, Javelin Odyssee, Javelin Legacy, Student
Javelin und Student Odyssee

Status: **verpflichtende Modifikation vor dem nächsten Sprung!**

Betrifft: Probleme mit dem Cutter beim Schneiden des Loops

Grund: Aufgrund mehrerer Vorkommnisse mit Cutterproblemen des Öffnungsautomaten
ARGUS der Firma Aviacom, bei denen der Loop nicht oder nicht korrekt
geschnitten wurde, zieht die Firma Sun Path die Einbauerlaubnis des
Öffnungsautomaten Argus in alle ihrer Produkte zurück.

Maßnahmen: Diese Gurtzeuge dürfen vom technischen Personal nicht mehr gepackt werden,
wenn ein Argus installiert ist. Springer, die diese Systeme benutzen, müssen den
Öffnungsautomaten vor dem nächsten Sprung ausbauen.
Diese Regelung gilt bis die Vorfälle aufgeklärt sind und der Hersteller des
Öffnungsautomaten eine erprobte und getestete Lösung für das Grundproblem
gefunden hat und Sun Path sein Service Bulletin widerruft.

Durchzuführen bis: **Vor dem nächsten Sprung!**

Bemerkungen: im Anhang: Service Bulletin # SBSP 006 vom 22.03.2011.

Verteiler: Techniker, Warte, Händler, Vereine, Sprungzentren.

Dresden, den 22.03.2011
Chris Buß - Referat Technik DFV

Ralf Homuth – Geschäftsstellenleiter VuPL



SERVICE BULLETIN

DATE: March 22, 2011 SERVICE BULLETIN# SPSB006 # OF PAGES: 2
SUBJECT: Aviacom SA/NV Argus AAD installation approval in SUN PATH PRODUCTS, INC equipment
STATUS: **MANDATORY** PMP#: N/A

IDENTIFICATION: JAVELIN, JAVELIN ODYSSEY, JAVELIN LEGACY, STUDENT JAVELIN, AND STUDENT ODYSSEY

BACKGROUND: Over the past three years and particularly in the last several months, there have been documented reports from the field of Argus AAD firings where there was a failure to cut the reserve closing loop completely. Aviacom SA/NV, the manufacturer of the Argus, has been contacted concerning these incidents, and to our knowledge to date, they have not yet identified the root cause of the problem, nor have they suggested a viable solution.

With certain container designs, this failure mode may interfere with or prevent manual activation of the reserve parachute system. When the AAD cutter is located ABOVE the reserve pilot chute, as it is in some common harness and container systems, if the cutter fails to sever the loop, pulling the reserve ripcord may not be sufficient to fully open the reserve container and may result in a fatality. Even though the cutter is located below the reserve pilot chute on Sun Path Products, Inc. harness/containers, this failure to cut the reserve-closing loop fully could cause a significant delay, which could result in a fatality.

There is also a second and potentially more serious safety issue with a partially cut loop. In addition to the above scenario, a partially cut loop could cause an unwanted reserve deployment on a later jump at an inopportune time. This could result in grave consequences, specifically while floating, during exit, or while others are in freefall above said jumper. In reviewing the reports, it appears that the pilot chute coming out when not expected on the ground after an AAD firing and not cutting the loop highlights this possibility.

This second scenario is far more dangerous since it has the potential of taking out a whole plane load of jumpers or causing a freefall collision, whereas the interference scenario just takes out one jumper, and only if he/she happens to need their reserve on the next or subsequent jumps.

In light of the seriousness of the above potential scenarios, Sun Path Products, Inc. is hereby withdrawing approval of the installation of Argus AADs in any and all of their harness and container systems. This action will remain in effect until such time as Aviacom SA/NV has identified the root cause of the cutter failure mode and has developed a proven and tested solution to resolve it to our satisfaction and until further notice.

SERVICE BULLETIN

14 CFR Part 65.129(e) states that “No certificated parachute rigger may **PACK**, maintain, or alter a parachute in any manner that deviates from the procedures approved by the administrator or the manufacturer of the parachute.” Sun Path Products, Inc. no longer approves any procedures to install the Argus AAD in Sun Path products, and hereby rescinds any prior approved procedures to do so. Because of this cancellation of the approval of the installation of the Argus AAD in Sun Path products, it could now be a violation of 14 CFR Part 65.129(e) if a certificated parachute rigger were to pack a Sun Path Products, Inc. harness and container system with an Argus AAD installed. It could also be a violation of 14 CFR Part 65.129(b), if, because of the installation of an Argus AAD, a parachute were to be deemed by the FAA to not be safe for emergency use.

SERVICE BULLETIN: All users of an Aviacom SA/NV Argus equipped Sun Path Products, Inc. harness and container system should remove the Argus AAD from their system, prior to making ANY further jumps with the system.

COMPLIANCE DATE: March 22, 2011

AUTHORITY:

DAVID L. SINGER, DIRECTOR OF ENGINEERING
Sun Path Products, Inc.
404 West Edinborough Ave, Raeford NC 28376 USA
Telephone: 910-875-9002
FAX: 910-875-9272
Email: dave@sunpath.com

DISTRIBUTION:

1. All Sun Path Products Dealers
2. PIA Technical Committee
3. PIA Rigging Committee
4. National Aero Clubs, Parachuting Section
5. All Parachuting publications
6. Military Parachute Organizations
7. FAA MIDO SAVANNA
8. FAA ACO ATLANTA
9. Aviacom SA/NV